Service-Information

Sail Auxiliary - D-7 Group No. 13 Fuel Lift Pump	June 4, 1981	Bulletin No. 13001 (1002)

Subject: Securing Fuel Lift Pump

The securing of the fuel lift pump has been improved. From engine serial number 0956 the fuel lift pump is fastened with studs using Loc Tite 601 and self-locking nuts.

Previously, the lift pump was fastened with hexagon head bolts.

In case the fuel lift pump becomes loose, we suggest that the following parts be used to replace the previous securing arrangement.

Part Number	Description	Quantity
07 11 9 908 295	Stud	
07 12 9 922 704	Self-locking Nut	2

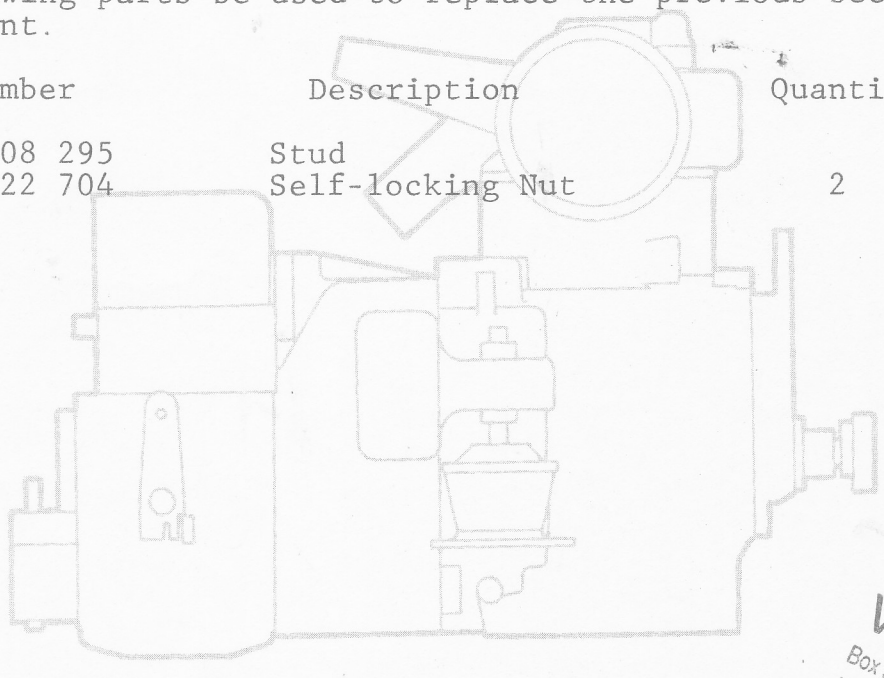

V12 Engineering
Box 50, Ontario, Canada P0X 1C0
www.bmwmarine.net

Griff Fenton
Service Manager
BMW-NA MARINE
Montvale, NJ 07645

Please route and initial before filing