BMW Marine GmbH

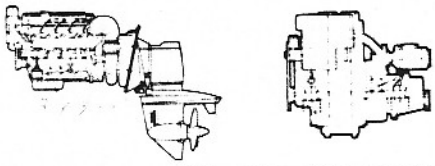

Service-Information

Baugruppe Cataloque group	Betroffene Modelle Affected models	Mitteilung Nr. Bulletin no	München
11	D 35 / D 50	KD 15/83A E	August 12, 1983

Subject: New oil cooler

These engines are now equipped with a thermostat controlled oil cooler. Partnumber of this new oil cooler complete is 11 44 1 761 018.

The material of the cover and angle flange has been improved and is made of seawater resistant cast copper alloy. The new cover 11 44 1 761 109 can be installed on the old style cooler. The thickness of the cover has been increased. Check during installation that there is sufficient thread on the stud to fasten the nut.

In case you encounter corrosion problems with the old style cooler it is possible to install the new oil cooler.

For the D 35 you need also a new bracket, partnumber 11 44 1 761 024 and longer trunnion bolt, partnumber 11 44 1 761 026.

The new bracket for the D 50 has partnumber 11 44 1 761 025.

The new oil cooler has been installed on all 2- and 3-cylinder diesel engines starting with serialnumber:

D 35	6012820001265
D 50	6112820001371
D 35-2	6012820001259
D 50-2	6112820001332

NOTE: This bulletin supersedes bulletin no. 15/83 dated July 25, 1983.

Faithfully yours,

BMW MARINE GMBH
Service Department

i.A. J.P. Roszbach i.A. D. Hoffmann

V12 Engineering
Box 50, Ontario, Canada P0X 1C0
www.bmwmarine.net